

# CRANE SCALE


## OCS-Z

### Features

- High strength load receptor
- Steel case
- 56mm LED display
- Standard bow shackle
- Standard eye hook
- High capacity rechargeable battery
- Infra-red remote control

### Functions

- Zero
- Tare
- Hold
- Battery supervision
- Overload alarm/record

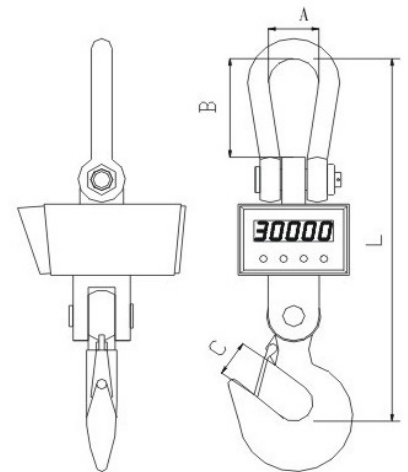

Max Cap.	A mm	B mm	C mm	L mm
10t	105	140	70	850
20t	150	180	80	950

### Specification

Tare Range	100% F.S.
Zero Range	4% F.S.
Safe Overload	120% F.S.
Overload Alarm	100% F.S.
Battery	6V/Ah
Battery Life	>80h
Temperature Range	-10C ~ 40C

Max Capacity	Min Capacity	Degree	Number
kg	kg	kg	
10t	100kg	5kg	2000
20t	200kg	10kg	2000

